


Last Modified: 07-05-2024	6.11:8.1.0	Doc ID: RM100000002JQ90
Model Year Start: 2024	Model: Land Cruiser	Prod Date Range: [02/2024 -]
Title: INTERIOR PANELS / TRIM: FRONT CONSOLE BOX (w/o Cool Box): REMOVAL; 2024 MY Land Cruiser [02/2024 -]		

REMOVAL

CAUTION / NOTICE / HINT

COMPONENTS (REMOVAL)

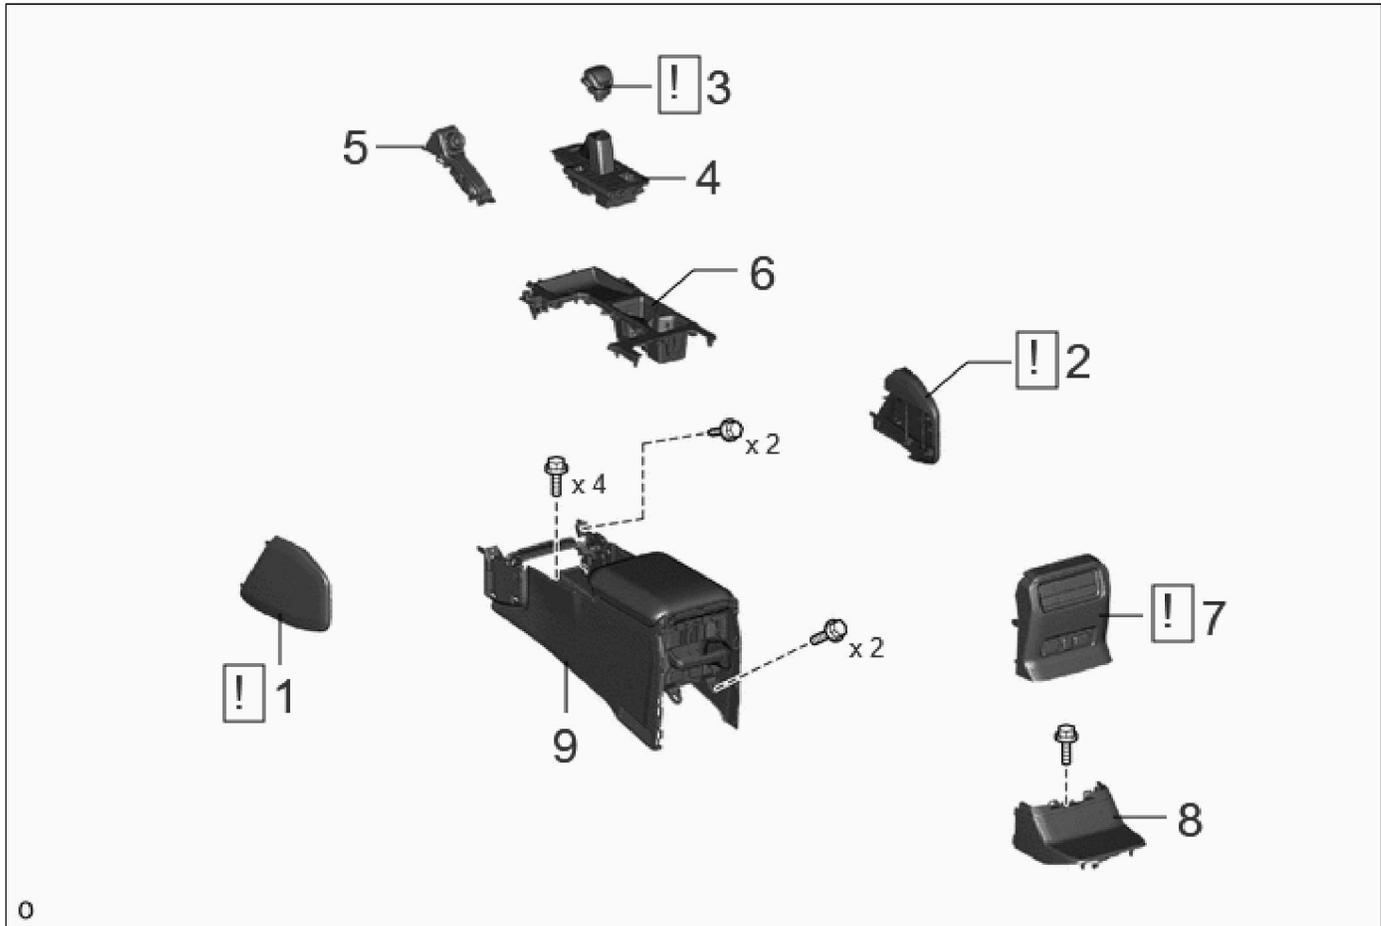


PROCEDURE		PART NAME CODE			
1	LOWER NO. 1 INSTRUMENT PANEL PAD SUB-ASSEMBLY	55402E	WFO	-	-
2	LOWER NO. 2 INSTRUMENT PANEL PAD SUB-ASSEMBLY	55403G	WFO	-	-
3	SHIFT LEVER KNOB SUB-ASSEMBLY	33504F	WFO	-	-
4	UPPER CONSOLE PANEL ASSEMBLY	-	-	-	-
5	INTEGRATION CONTROL AND PANEL SUB-ASSEMBLY	84012	-	-	-
6	UPPER CONSOLE PANEL SUB-ASSEMBLY	58804A	-	-	-

	PROCEDURE	PART NAME CODE			
7	CONSOLE REAR END PANEL SUB-ASSEMBLY	58903A		-	-
8	NO. 2 CONSOLE REAR END PANEL SUB-ASSEMBLY	58904C	-	-	-
9	CONSOLE BOX ASSEMBLY	-	-	-	-

PROCEDURE

1. REMOVE LOWER NO. 1 INSTRUMENT PANEL PAD SUB-ASSEMBLY

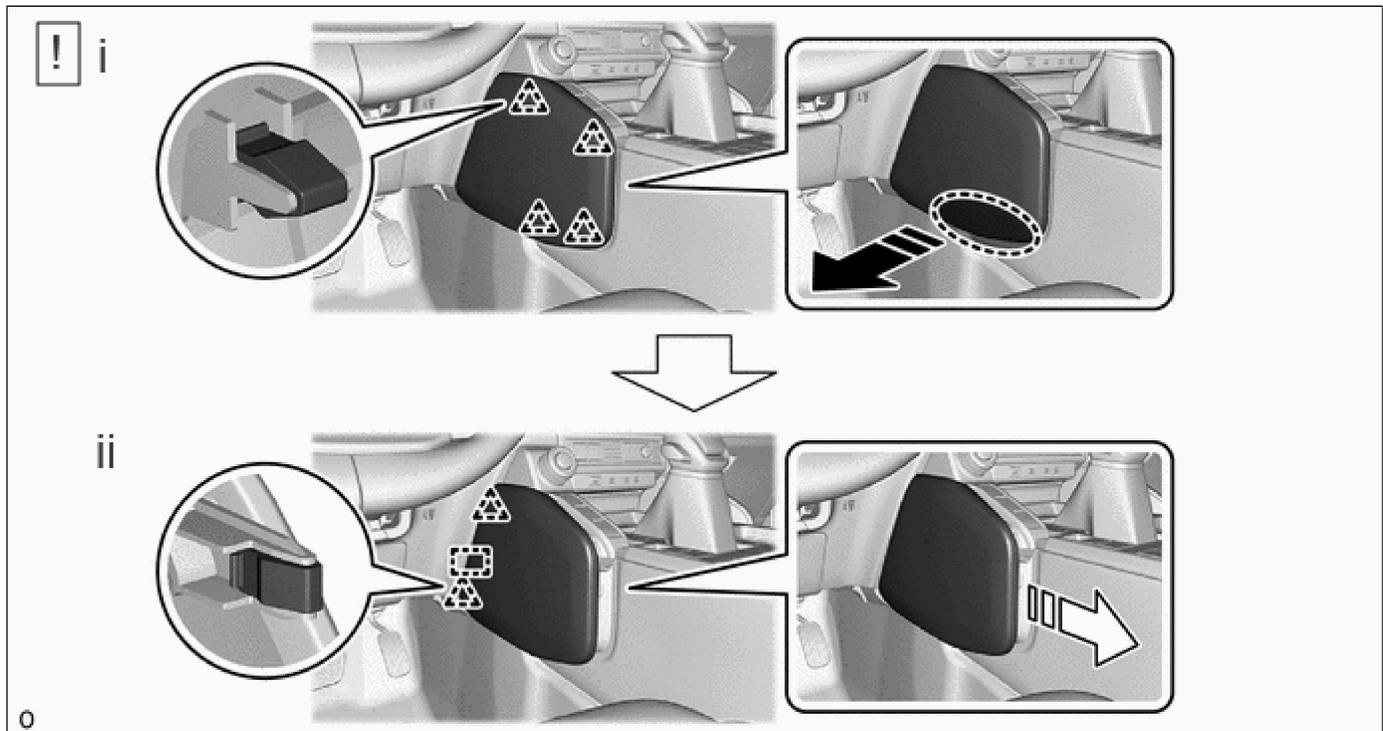


	Place Hands Here		Remove in this Direction (1)
	Remove in this Direction (2)	-	-

(1) Place your hand as shown in the illustration, detach the clip.

(2) Detach the clip and guide and remove the lower No. 1 instrument panel pad sub-assembly.

2. REMOVE LOWER NO. 2 INSTRUMENT PANEL PAD SUB-ASSEMBLY

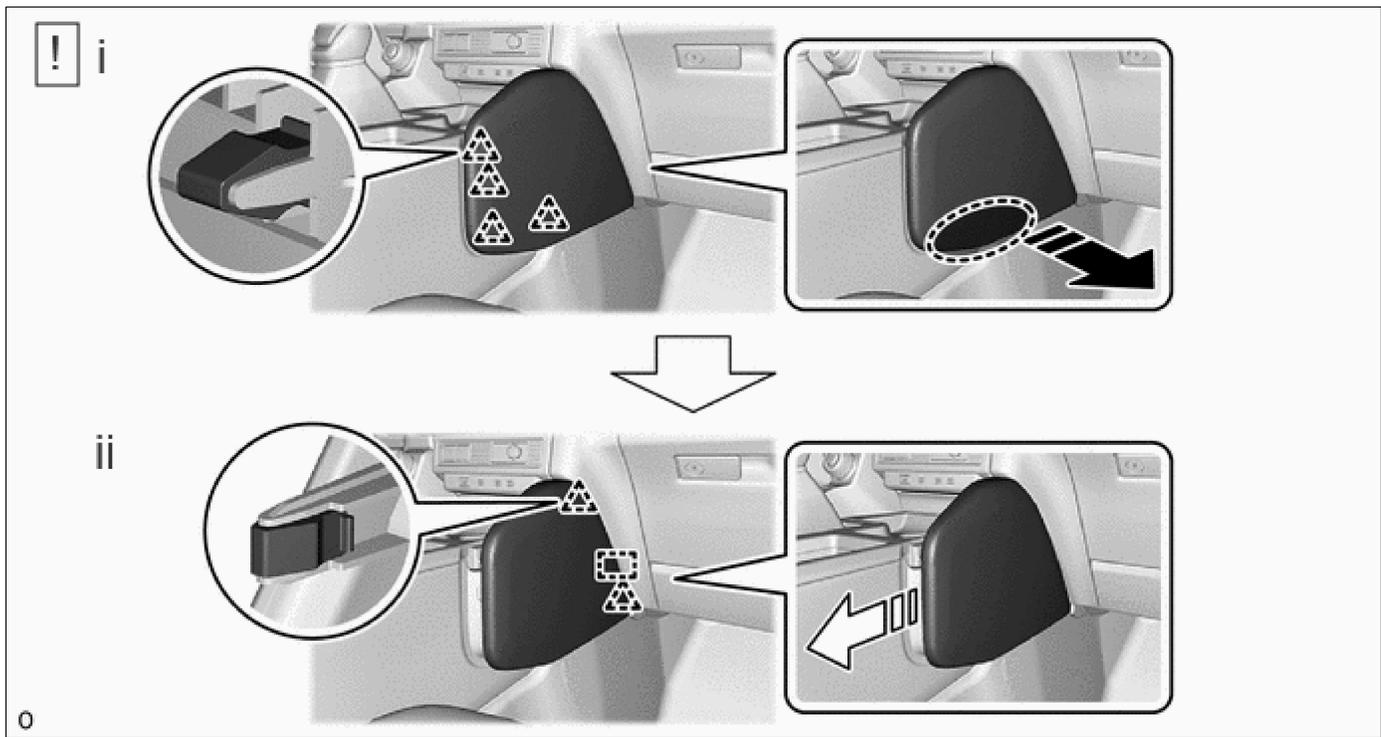

	Place Hands Here		Remove in this Direction (1)
	Remove in this Direction (2)	-	-

(1) Place your hand as shown in the illustration, detach the clip.

(2) Detach the clip and guide and remove the lower No. 2 instrument panel pad sub-assembly.


3. REMOVE SHIFT LEVER KNOB SUB-ASSEMBLY

	Click here 
---	--

4. REMOVE UPPER CONSOLE PANEL ASSEMBLY


HINT:

The illustrations are representative examples, and details may differ.

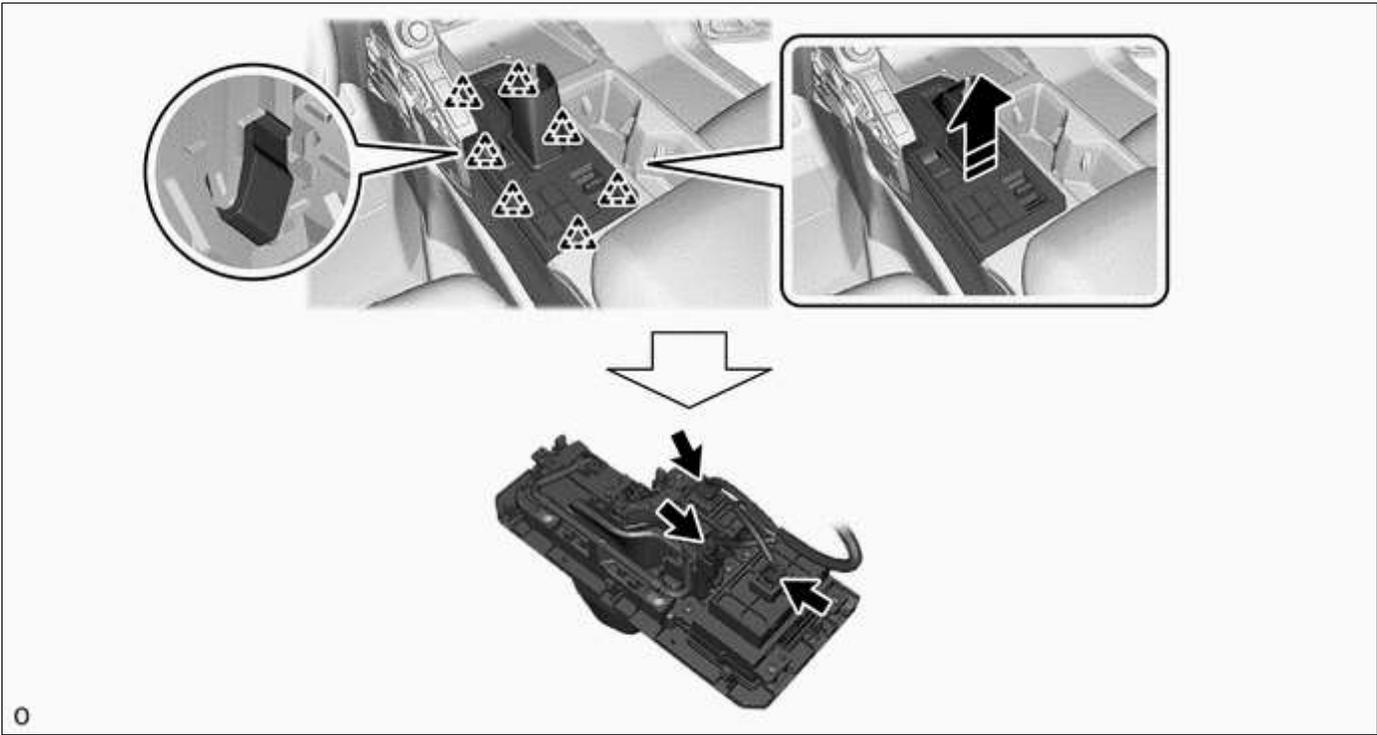

	Remove in this Direction	-	-
---	--------------------------	---	---

5. REMOVE INTEGRATION CONTROL AND PANEL SUB-ASSEMBLY

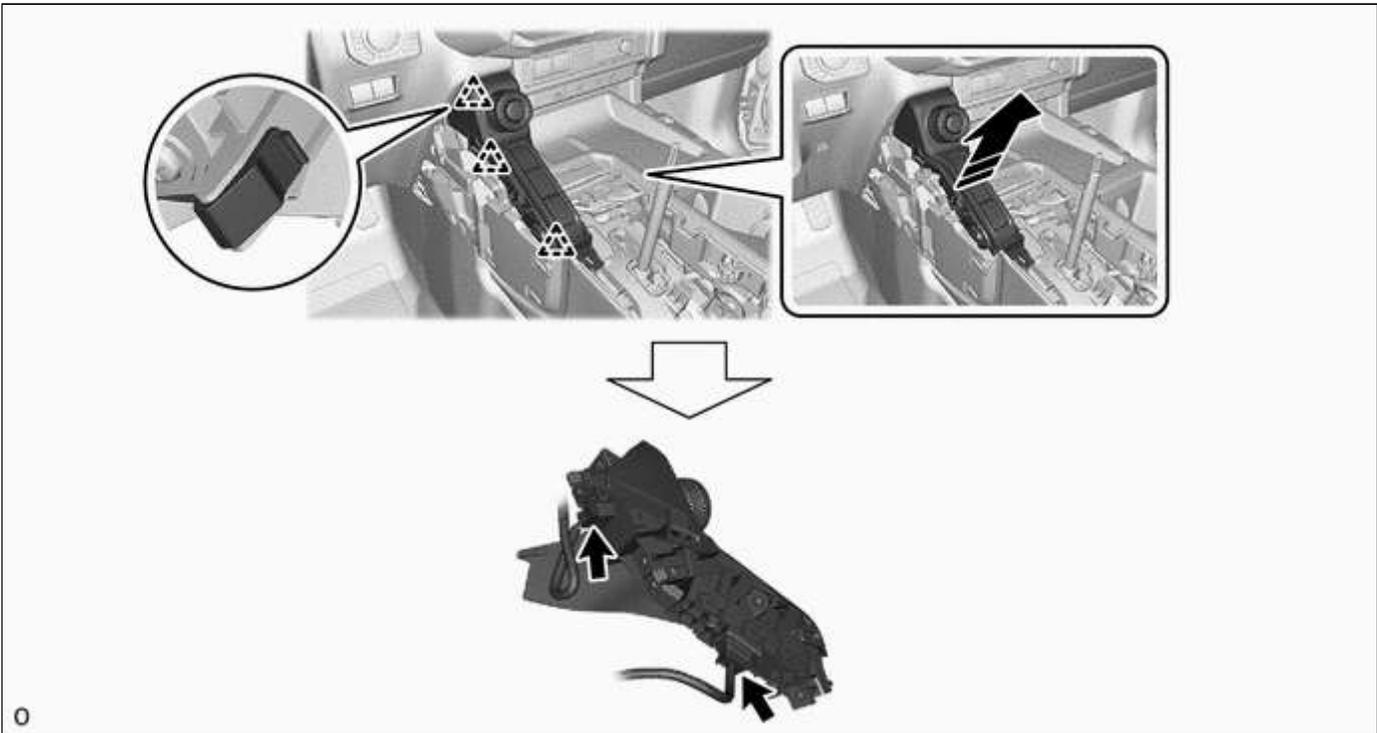


	Remove in this Direction	-	-
---	--------------------------	---	---

6. REMOVE UPPER CONSOLE PANEL SUB-ASSEMBLY

HINT:

The illustrations are representative examples, and details may differ.

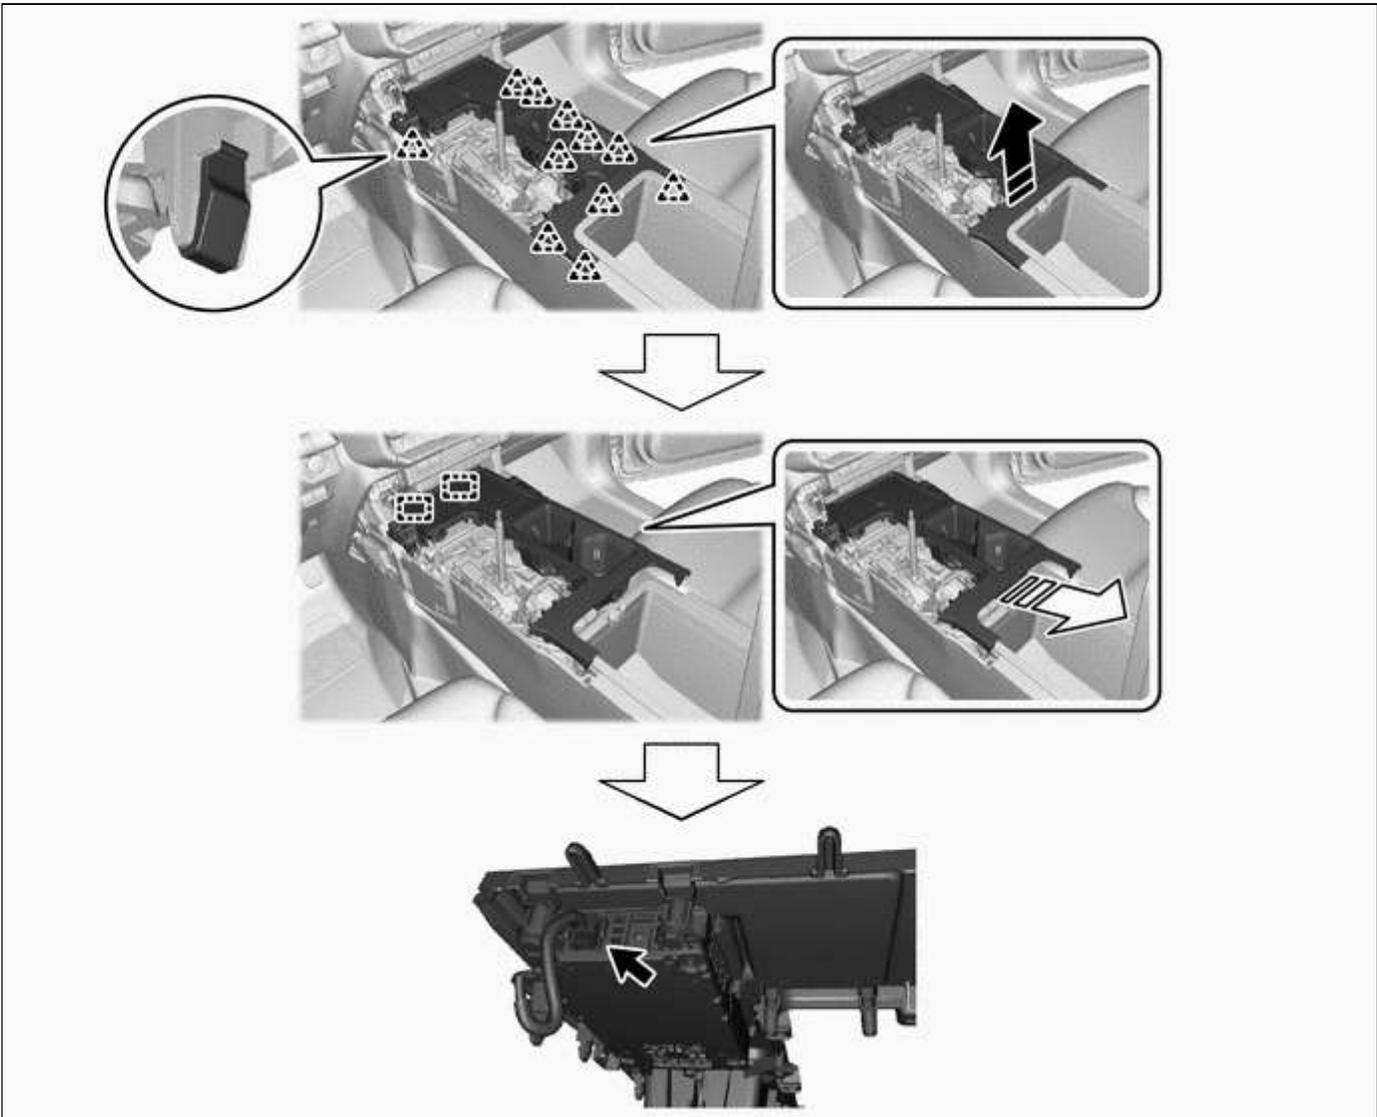


	Remove in this Direction (1)		Remove in this Direction (2)
--	------------------------------	--	------------------------------

7. REMOVE CONSOLE REAR END PANEL SUB-ASSEMBLY

HINT:


The illustrations are representative examples, and details may differ.

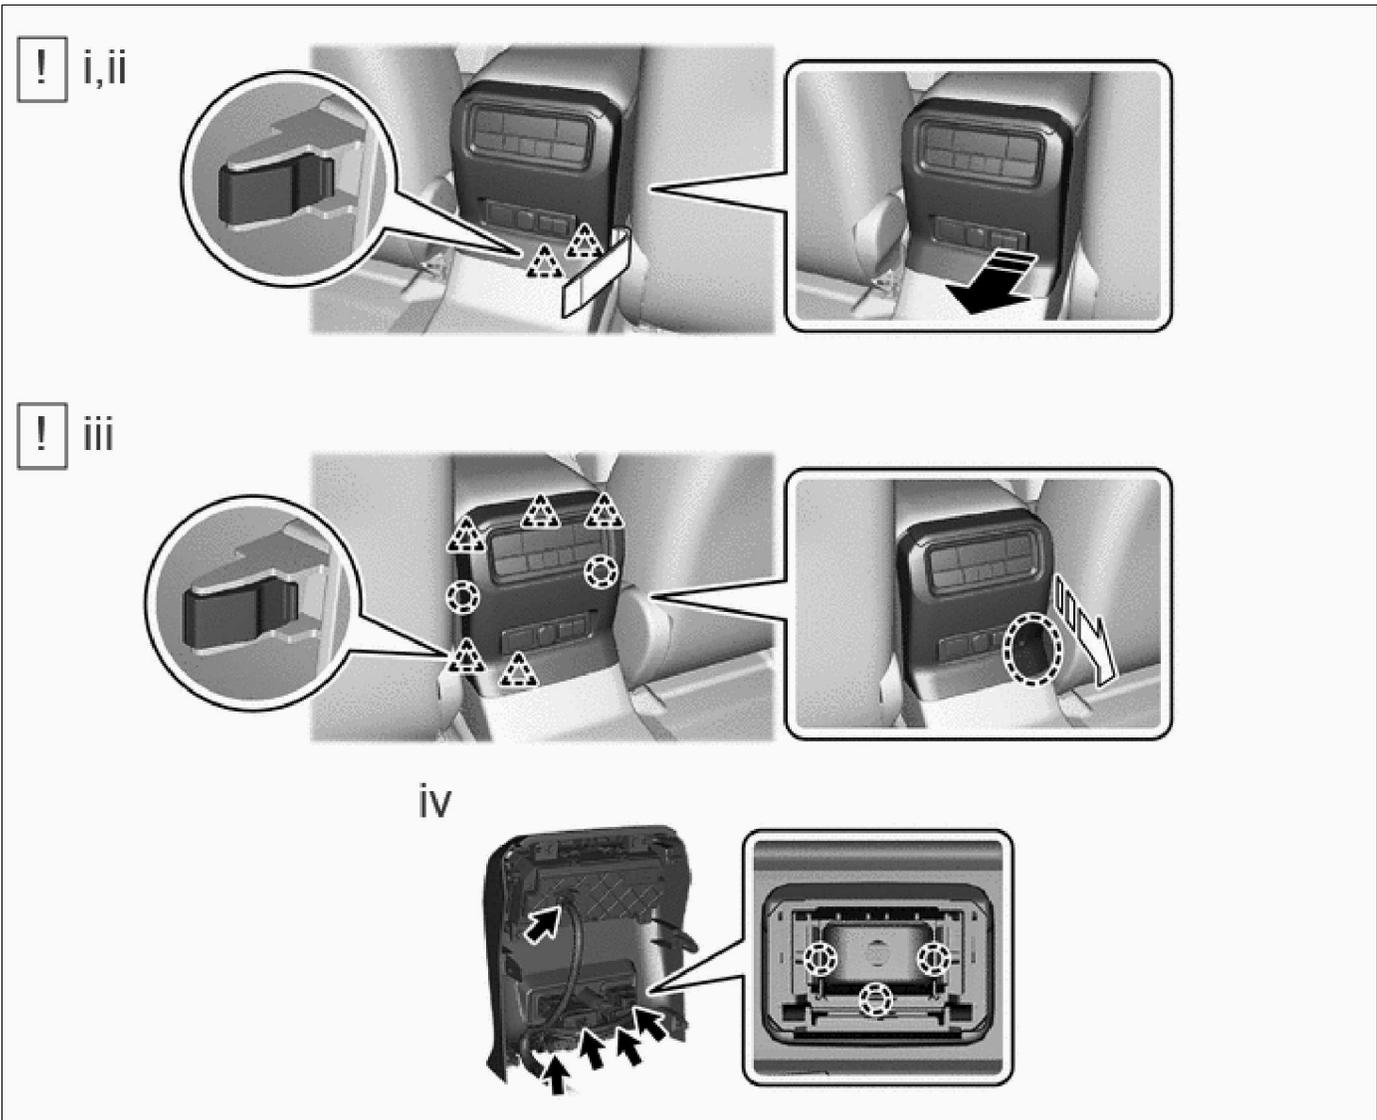

	Place Hands Here		Remove in this Direction (1)
	Remove in this Direction (2)	-	-

- (1) Insert moulding remover D in the position shown in the illustration.
- (2) Place your hand in the gap as shown in the illustration, detach the clip.
- (3) Place your hand as shown in the illustration, detach the claw and clip and remove the rear console end panel sub-assembly.
- (4) Disconnect the each connectors and detach the claw.

8. REMOVE NO. 2 CONSOLE REAR END PANEL SUB-ASSEMBLY



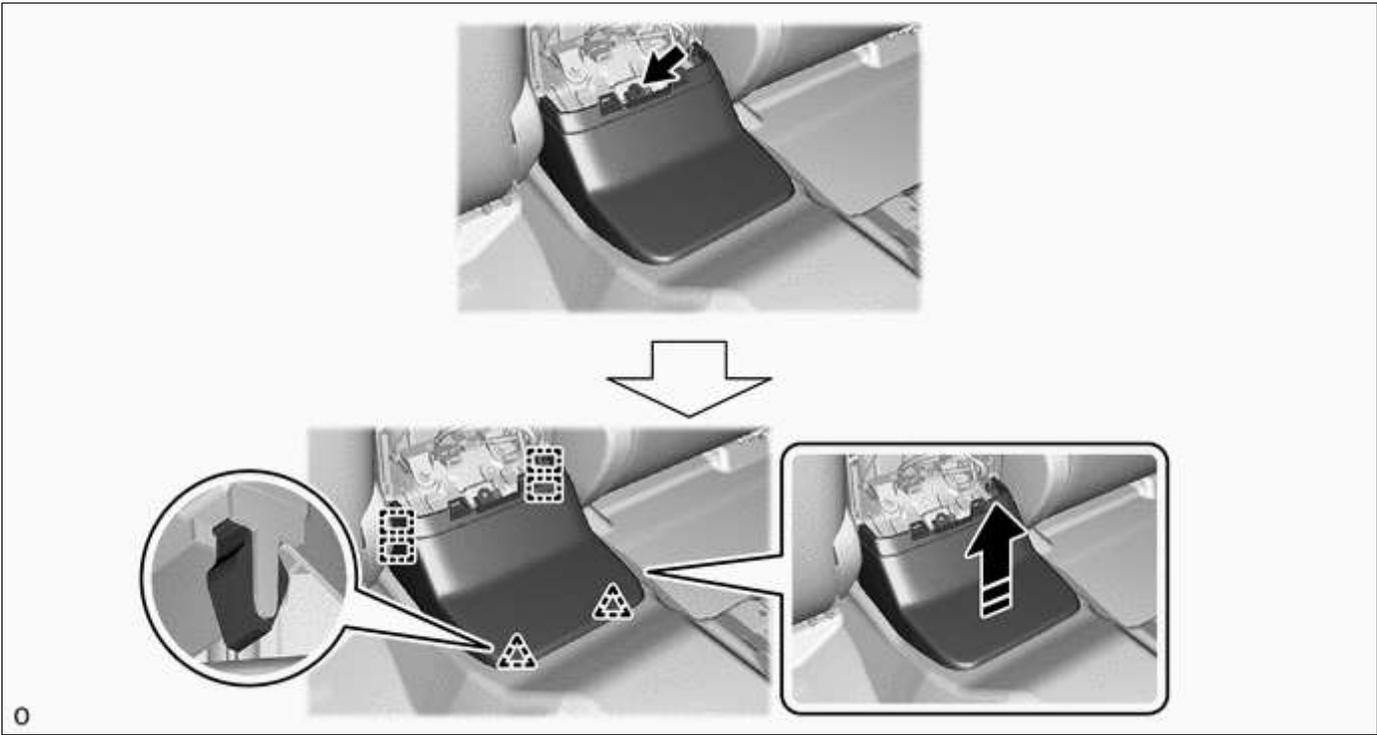


	Remove in this Direction	-	-
---	--------------------------	---	---

9. REMOVE CONSOLE BOX ASSEMBLY

HINT:

The illustrations are representative examples, and details may differ.

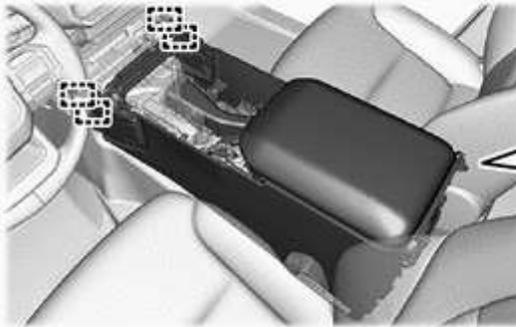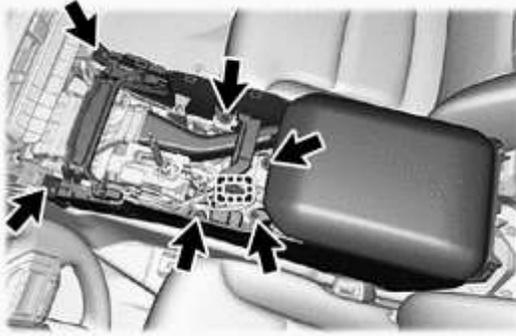

0



Remove in this Direction

-

-



TOYOTA