

Last Modified: 07-05-2024	6.11:8.1.0	Doc ID: RM100000002JRHD
Model Year Start: 2024	Model: Land Cruiser	Prod Date Range: [02/2024 -]
Title: AUDIO / VIDEO: RADIO RECEIVER: REMOVAL; 2024 MY Land Cruiser [02/2024 -]		

REMOVAL

CAUTION / NOTICE / HINT


The necessary procedures (adjustment, calibration, initialization or registration) that must be performed after parts are removed, installed or replaced during the radio and display receiver assembly removal/installation are shown below.




Necessary Procedure After Parts Removed/Installed/Replaced

REPLACED PART OR PERFORMED PROCEDURES	NECESSARY PROCEDURES	EFFECT/INOPERATIVE FUNCTION WHEN NECESSARY PROCEDURES ARE NOT PERFORMED	LINK
Radio and display receiver assembly	Register Vehicle Information	-	<div>INFO</div>
	Software update		


CAUTION / NOTICE / HINT

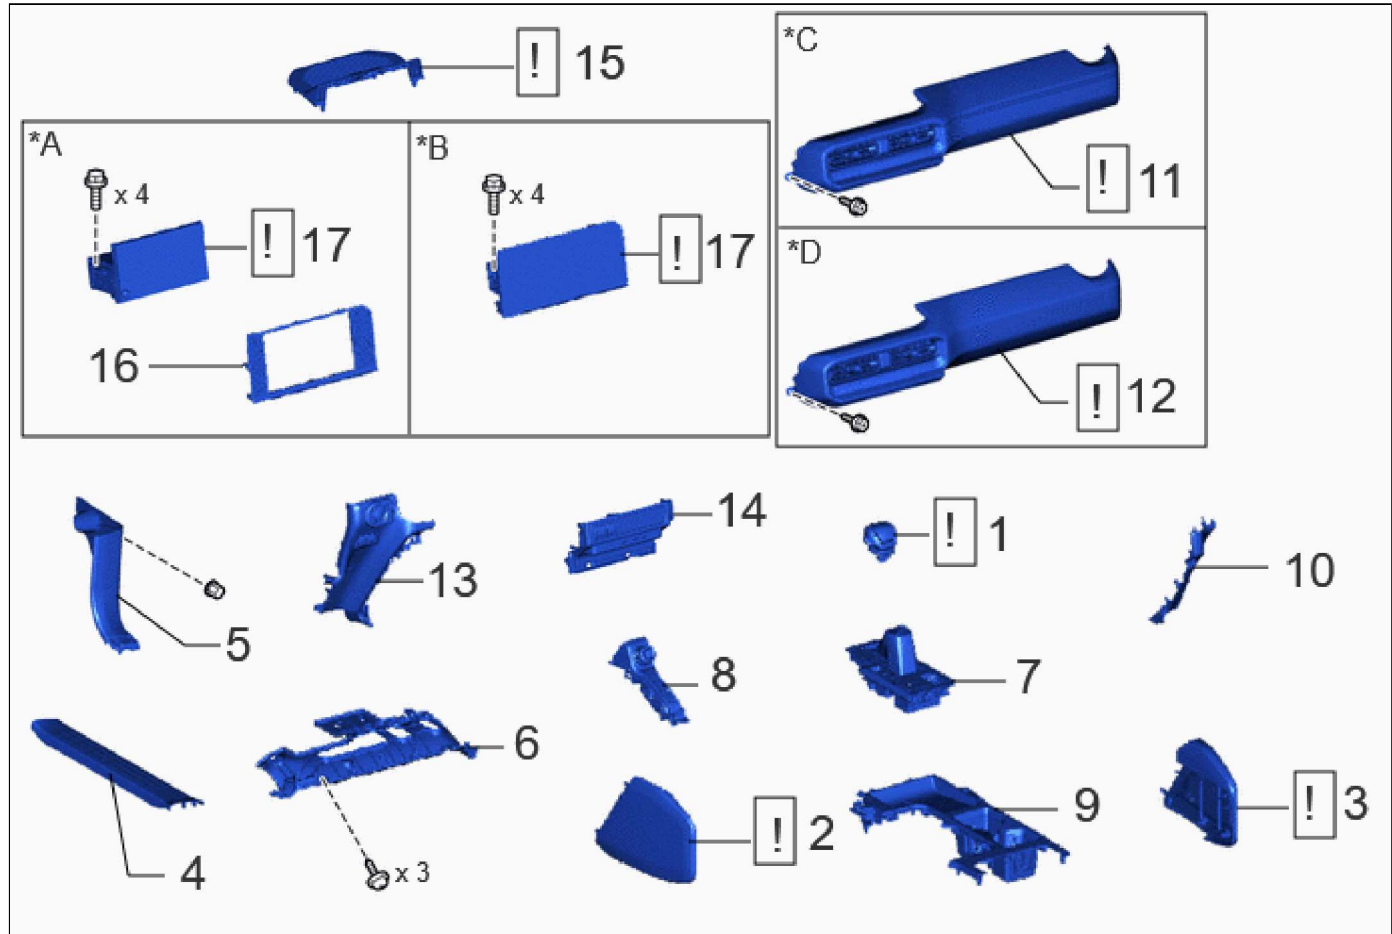


COMPONENTS (REMOVAL)




PROCEDURE		PART NAME CODE			
1	SHIFT LEVER KNOB SUB-ASSEMBLY	33504F	INFO	-	-
2	LOWER NO. 1 INSTRUMENT PANEL PAD SUB-ASSEMBLY	55402E	INFO	-	-
3	LOWER NO. 2 INSTRUMENT PANEL PAD SUB-ASSEMBLY	55403G	INFO	-	-
4	FRONT DOOR SCUFF PLATE LH	67914B	-	-	-
5	COWL SIDE TRIM BOARD LH	62112	-	-	-
6	NO. 1 INSTRUMENT PANEL UNDER COVER	55641	-	-	-
7	UPPER CONSOLE PANEL ASSEMBLY	-	-	-	-
8	INTEGRATION CONTROL AND PANEL SUB-ASSEMBLY	84012	-	-	-
9	UPPER CONSOLE PANEL SUB-ASSEMBLY	58804A	-	-	-
10	LOWER INSTRUMENT PANEL LH	55313	-	-	-
11	NO. 1 INSTRUMENT PANEL GARNISH SUB-ASSEMBLY	55011A	INFO	-	-
12	INSTRUMENT PANEL ORNAMENT	55461A	INFO	-	-
13	LOWER INSTRUMENT PANEL FINISH PANEL ASSEMBLY	55480D	-	-	-
14	CENTER INSTRUMENT CLUSTER FINISH PANEL SUB-ASSEMBLY	55405B	-	-	-
15	UPPER INSTRUMENT CLUSTER FINISH PANEL	55421B	INFO	-	-
16	CENTER INSTRUMENT CLUSTER FINISH PANEL	55412D	-	-	-
17	RADIO AND DISPLAY RECEIVER ASSEMBLY WITH BRACKET	-	INFO	-	-

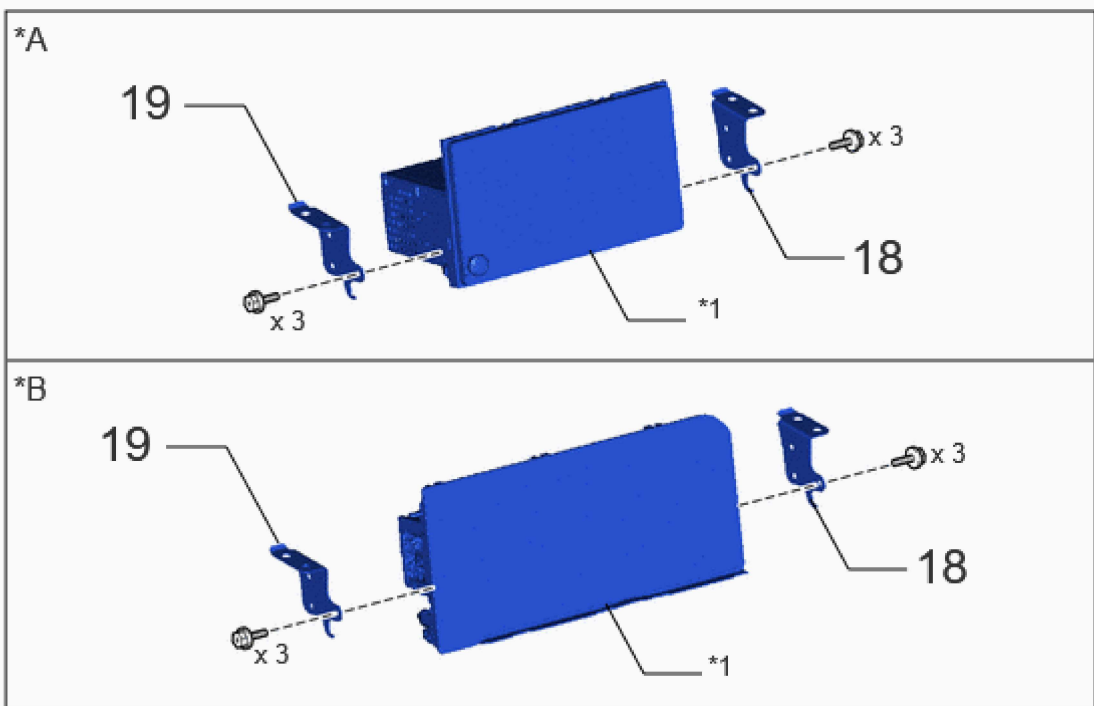


*A	for 8 Inch Display	*B	for 12.3 Inch Display
*C	for Type A	*D	for Type B



PROCEDURE		PART NAME CODE			
18	NO. 1 RADIO RECEIVER BRACKET	86211J	-	-	-
19	NO. 2 RADIO RECEIVER BRACKET	86212C	-	-	-

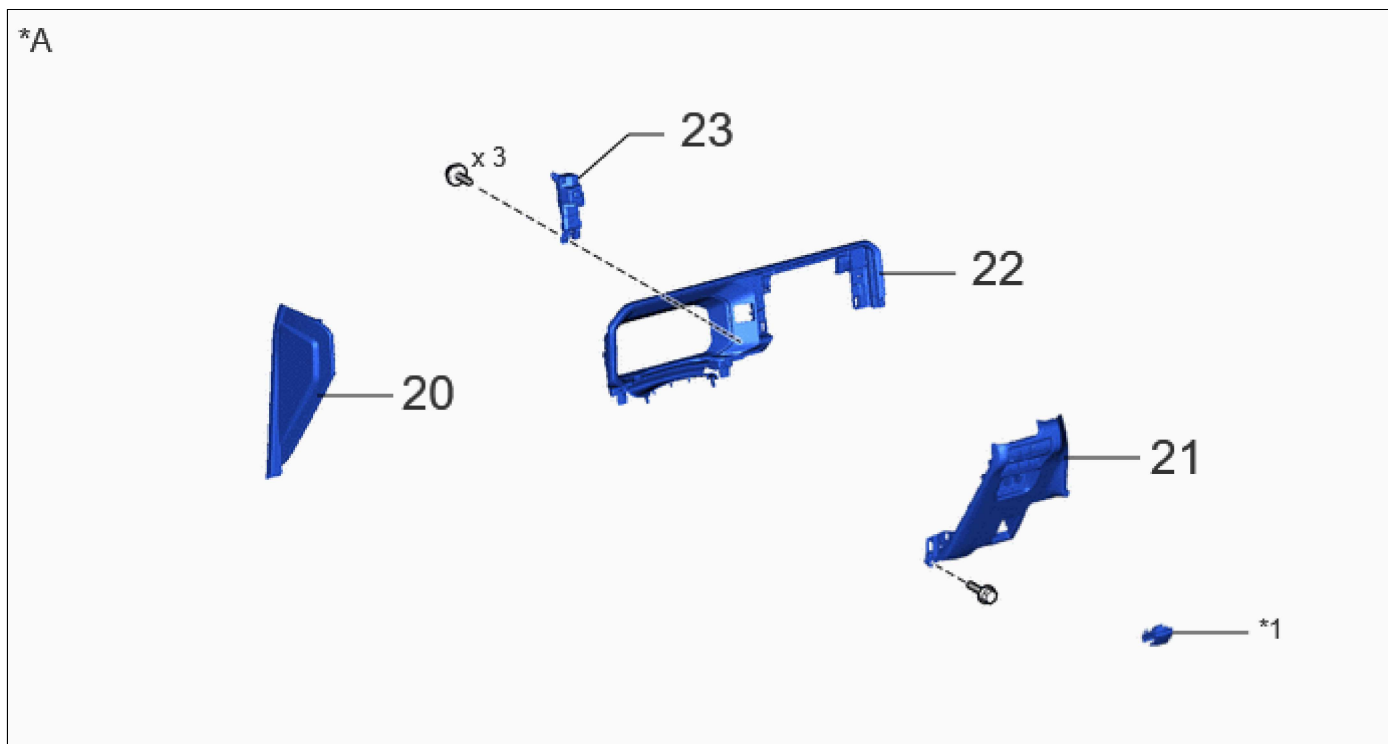*A	for 8 Inch Display	*B	for 12.3 Inch Display
*1	RADIO AND DISPLAY RECEIVER ASSEMBLY	-	-



PROCEDURE		PART NAME CODE			
20	INSTRUMENT SIDE PANEL LH	55318C	-	-	-
21	LOWER INSTRUMENT PANEL FINISH PANEL SUB-ASSEMBLY	55045	-	-	-
22	CENTER INSTRUMENT CLUSTER FINISH PANEL ASSEMBLY	55420A	-	-	-
23	SWITCH AND VOLUME ASSEMBLY	86170A	-	-	-

*A	for 12.3 Inch Display	-	-
*1	HOOD LOCK CONTROL LEVER SUB-ASSEMBLY	-	-

PROCEDURE

1. REMOVE SHIFT LEVER KNOB SUB-ASSEMBLY

	Click here INFO
---	---------------------------------

2. REMOVE LOWER NO. 1 INSTRUMENT PANEL PAD SUB-ASSEMBLY

Click here [INFO](#)

3. REMOVE LOWER NO. 2 INSTRUMENT PANEL PAD SUB-ASSEMBLY

(a) Use the same procedure described for the lower No. 2 instrument panel pad sub-assembly.

4. REMOVE FRONT DOOR SCUFF PLATE LH

Click here [INFO](#)

5. REMOVE COWL SIDE TRIM BOARD LH

Click here [INFO](#)

6. REMOVE NO. 1 INSTRUMENT PANEL UNDER COVER

Click here [INFO](#)

7. REMOVE UPPER CONSOLE PANEL ASSEMBLY

Click here [INFO](#)

8. REMOVE INTEGRATION CONTROL AND PANEL SUB-ASSEMBLY

Click here [INFO](#)


9. REMOVE UPPER CONSOLE PANEL SUB-ASSEMBLY

Click here [INFO](#)


10. REMOVE LOWER INSTRUMENT PANEL LH

Click here [INFO](#)

11. REMOVE NO. 1 INSTRUMENT PANEL GARNISH SUB-ASSEMBLY (for Type A)

	Click here INFO
---	---------------------------------

12. REMOVE INSTRUMENT PANEL ORNAMENT (for Type B)

	Click here INFO
---	---------------------------------

13. REMOVE LOWER INSTRUMENT PANEL FINISH PANEL ASSEMBLY

Click here [INFO](#)

14. REMOVE CENTER INSTRUMENT CLUSTER FINISH PANEL SUB-ASSEMBLY

Click here [INFO](#)

15. REMOVE UPPER INSTRUMENT CLUSTER FINISH PANEL

Click here [INFO](#)

16. REMOVE CENTER INSTRUMENT CLUSTER FINISH PANEL (for 8 Inch Display)


Click here [INFO](#)



17. REMOVE RADIO AND DISPLAY RECEIVER ASSEMBLY WITH BRACKET

HINT:

The illustrations are representative examples, and details may differ.

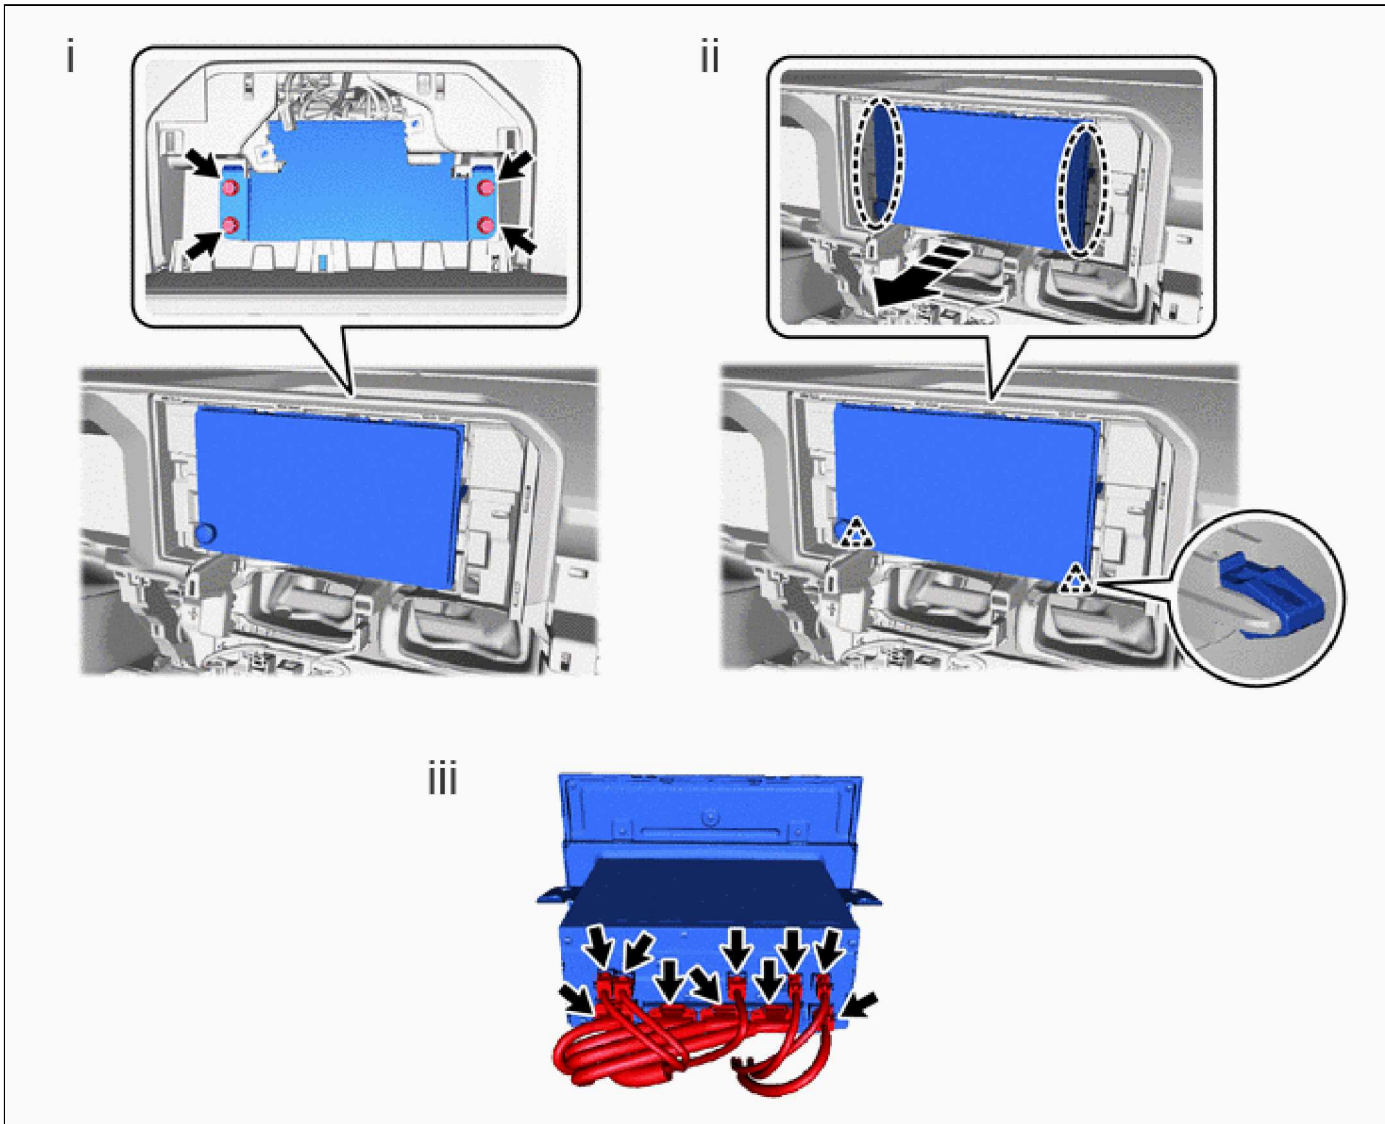(a) for 8 Inch Display:




	Place Hands Here		Remove in this Direction
---	------------------	---	--------------------------

(1) Remove the 4 bolts.

(2) Place your hands shown in the illustration and move it toward the rear of the vehicle to detach the clip.

(3) Disconnect each connector.

(b) for 12.3 Inch Display:

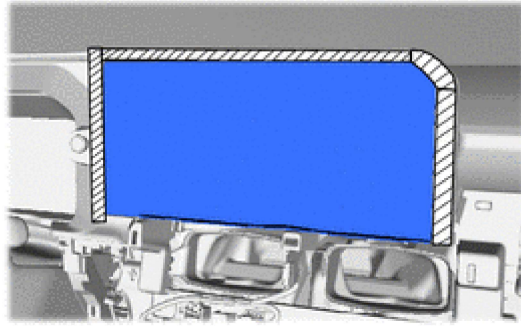

Protective tape



-

-



(1) Put protective tape around the radio and display receiver assembly with bracket.

(c) for 12.3 Inch Display:



i

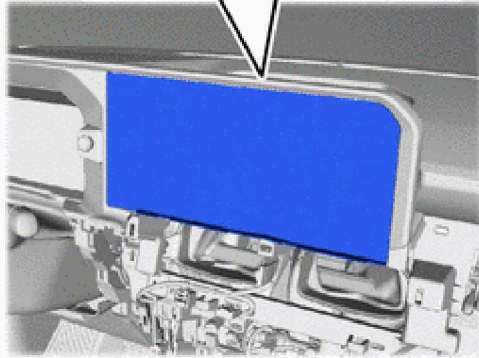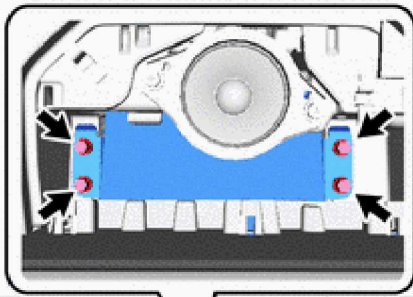


! ii

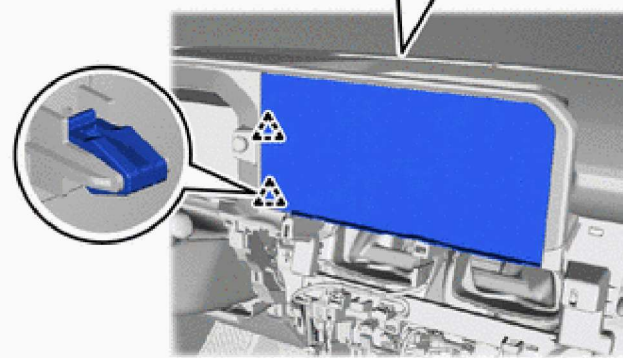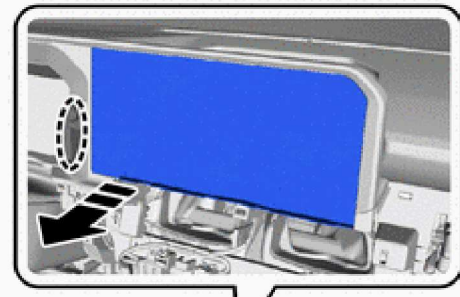

iii

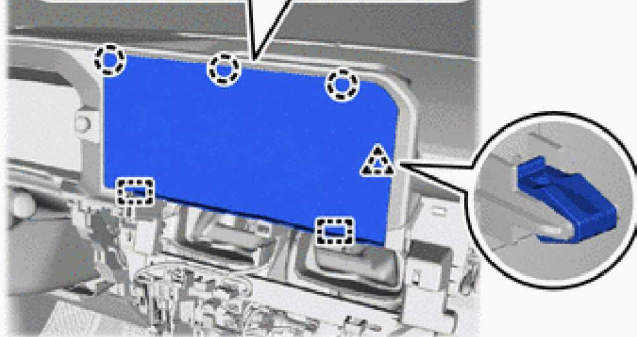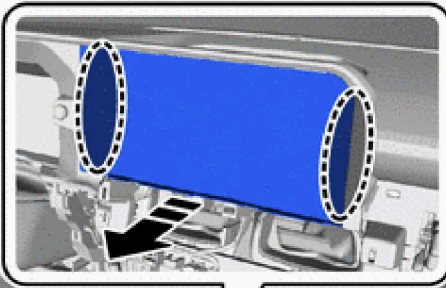

iv

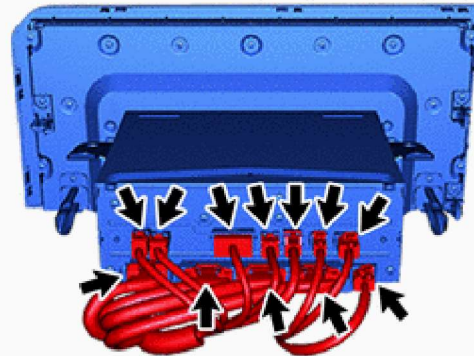


Place Hands Here



Remove in this Direction


- (1) Remove the 4 bolts.
- (2) While holding the position shown in the figure, detach the clip.
- (3) Place your hands shown in the illustration and move it toward the rear of the vehicle to detach the clip, claw and guide.
- (4) Disconnect each connector.

18. REMOVE NO. 1 RADIO RECEIVER BRACKET

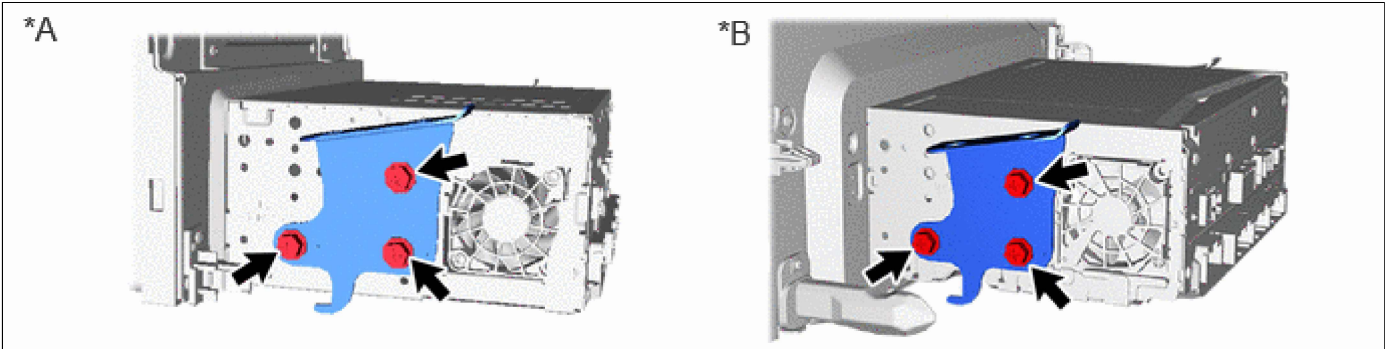

*A	for 8 Inch Display	*B	for 12.3 Inch Display
----	--------------------	----	-----------------------

19. REMOVE NO. 2 RADIO RECEIVER BRACKET

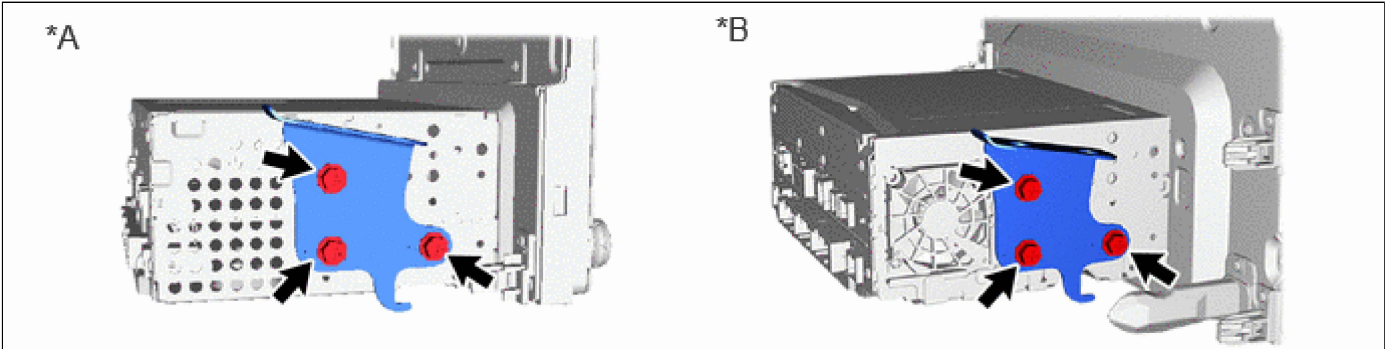

*A	for 8 Inch Display	*B	for 12.3 Inch Display
----	--------------------	----	-----------------------

20. REMOVE INSTRUMENT SIDE PANEL LH (for 12.3 Inch Display)

HINT:
Perform this procedure only when replacing the switch and volume assembly.

Click here [INFO](#)

21. REMOVE LOWER INSTRUMENT PANEL FINISH PANEL SUB-ASSEMBLY (for 12.3 Inch Display)

HINT:
Perform this procedure only when replacing the switch and volume assembly.

Click here [INFO](#)

22. REMOVE CENTER INSTRUMENT CLUSTER FINISH PANEL ASSEMBLY (for 12.3 Inch Display)

HINT:
Perform this procedure only when replacing the switch and volume assembly.

Click here [INFO](#)

23. REMOVE SWITCH AND VOLUME ASSEMBLY (for 12.3 Inch Display)

HINT:
Perform this procedure only when replacing the switch and volume assembly.

