





Last Modified: 07-05-2024	6.11:8.1.0	Doc ID: RM100000002K9IU
Model Year Start: 2024	Model: Land Cruiser	Prod Date Range: [02/2024 -]
Title: EXTERIOR PANELS / TRIM: BACK DOOR OUTSIDE GARNISH: REMOVAL; 2024 MY Land Cruiser [02/2024 -]		

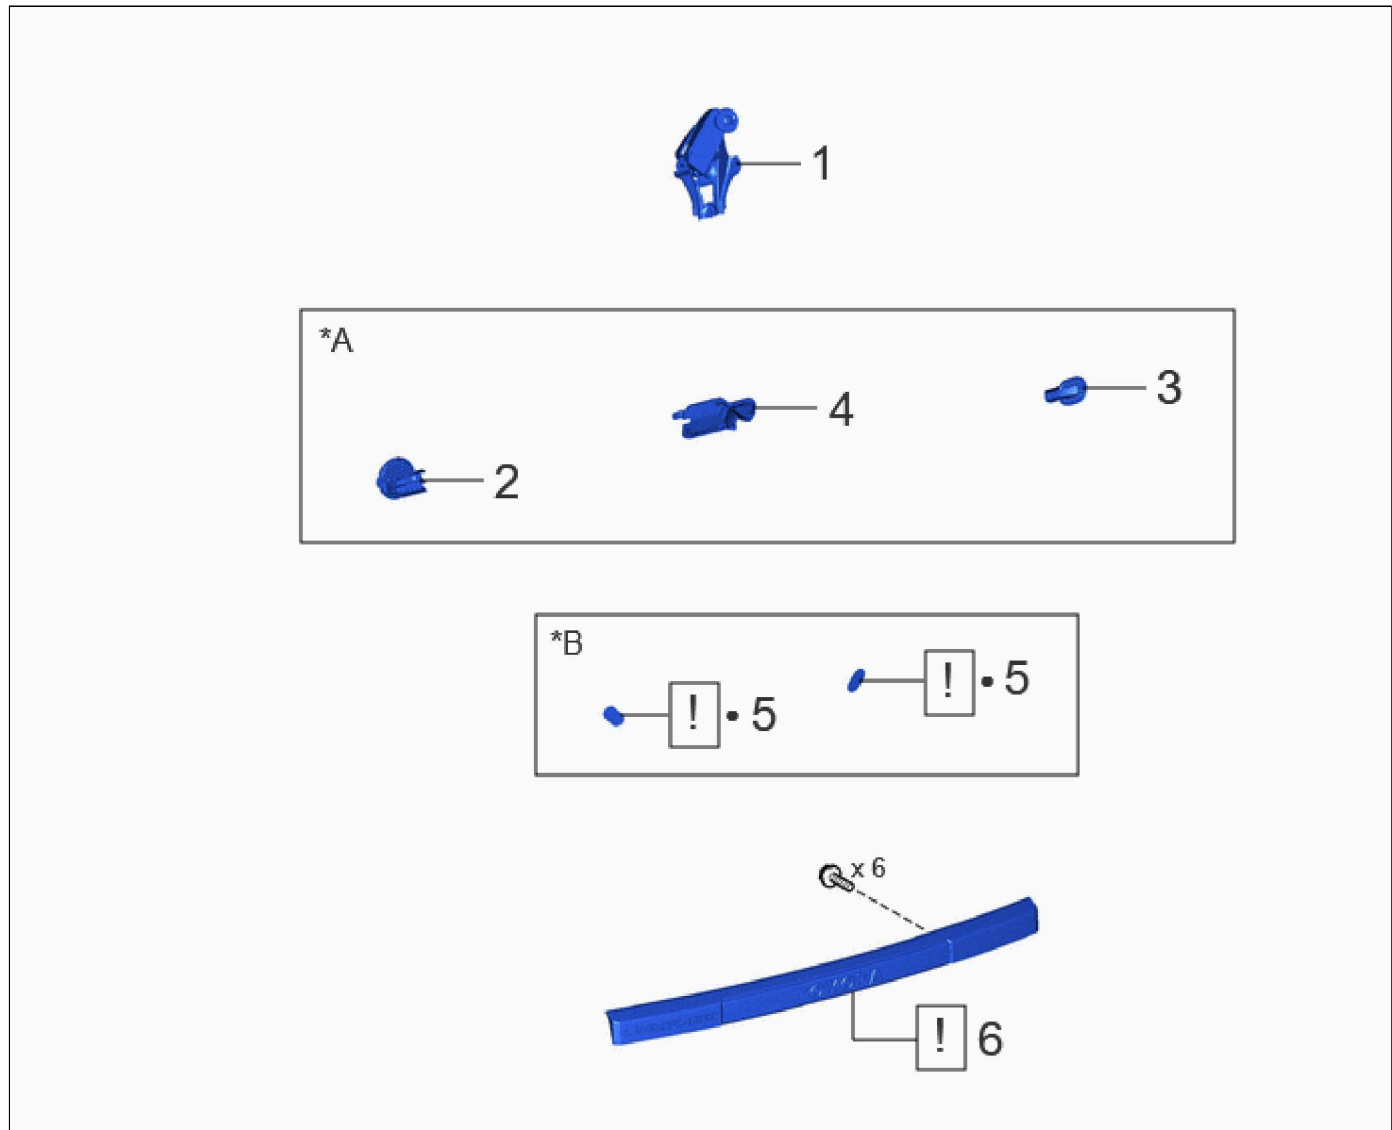


REMOVAL

CAUTION / NOTICE / HINT

COMPONENTS (REMOVAL)



PROCEDURE		PART NAME CODE			
1	REAR WIPER MOTOR ASSEMBLY	85110R	-	-	-
2	BACK DOOR NO. 4 SERVICE HOLE COVER	67768C	-	-	-

PROCEDURE		PART NAME CODE			
3	BACK DOOR NO. 3 SERVICE HOLE COVER	67767B	-	-	-
4	BACK DOOR NO. 1 SERVICE HOLE COVER	67765A	-	-	-
5	OUTER MIRROR PROTECTOR	-	INFO	-	-
6	BACK DOOR OUTSIDE GARNISH SUB-ASSEMBLY	76801	INFO	-	-

*A	w/ Cover	*B	w/ Back Door Speaker
•	Non-reusable part	-	-

PROCEDURE

1. REMOVE REAR WIPER MOTOR ASSEMBLY

Click here [INFO](#)

2. REMOVE BACK DOOR NO. 4 SERVICE HOLE COVER (w/ Cover)

Click here [INFO](#)


3. REMOVE BACK DOOR NO. 3 SERVICE HOLE COVER (w/ Cover)

Click here [INFO](#)

4. REMOVE BACK DOOR NO. 1 SERVICE HOLE COVER (w/ Cover)

Click here [INFO](#)

5. REMOVE OUTER MIRROR PROTECTOR (w/ Back Door Speaker)


	<p>NOTICE:</p> <p>When removing the outer mirror protector, if the double-sided tape is difficult to remove, heat the adhesive of the outer mirror protector using a heat light.</p>
---	---

Standard Value:

PART	TEMPERATURE
Outer Mirror Protector	20 to 30°C (68 to 86°F)

CAUTION:


- Do not touch the heat light and heated parts.
- Touching the heat light may result in burns.
- Touching heated parts for a long time may result in burns.

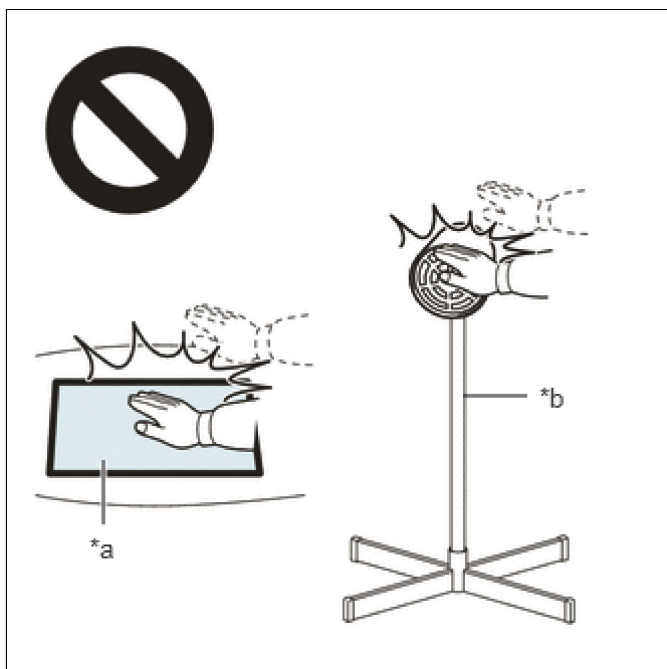

*a	Heated Part
*b	Heat Light


NOTICE:

Do not heat the outer mirror protector excessively.

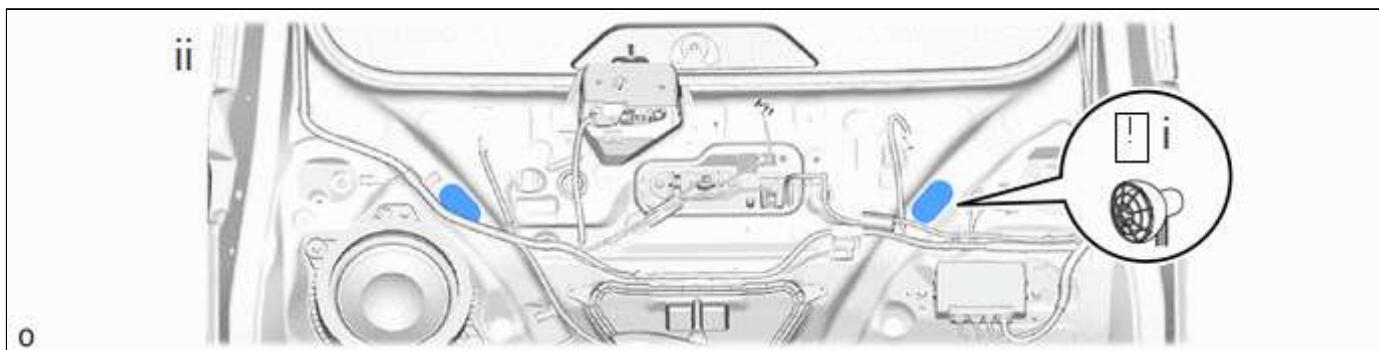


- (1) Heat the adhesive of the outer mirror protector using a heat light.
- (2) Remove the 2 outer mirror protectors.

6. REMOVE BACK DOOR OUTSIDE GARNISH SUB-ASSEMBLY

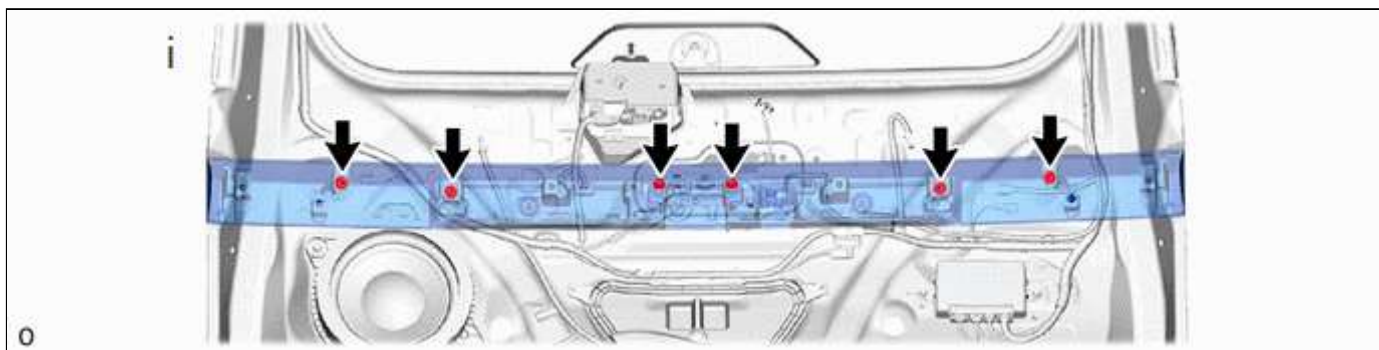

- (1) Remove the 6 bolts.

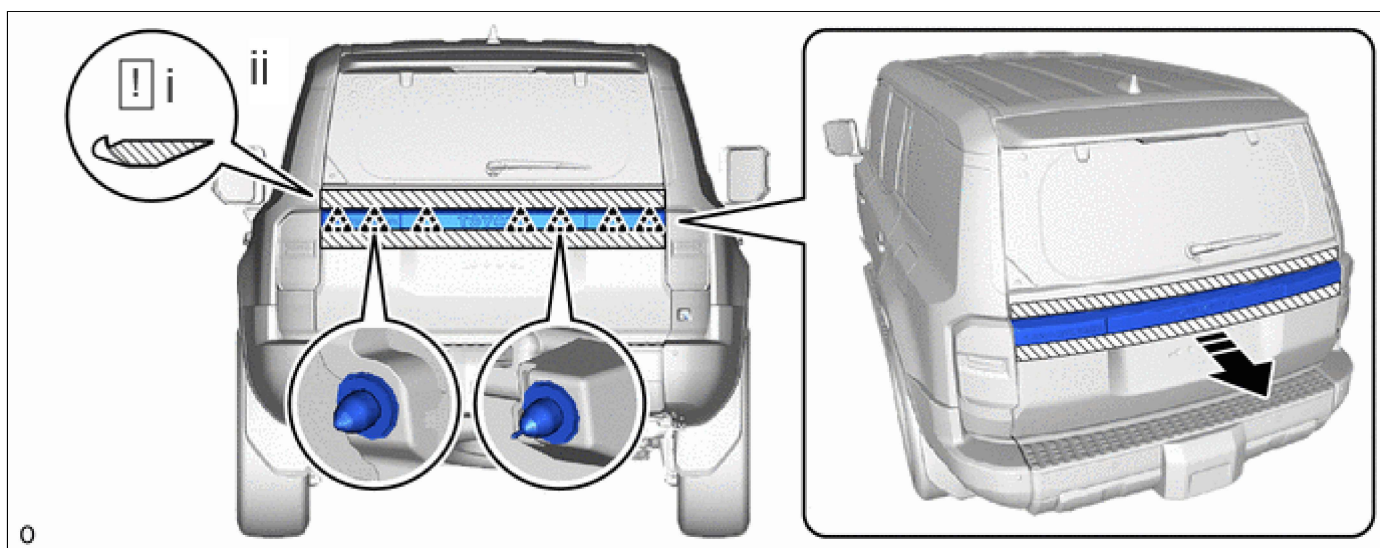

	Remove in this Direction	-	-
---	--------------------------	---	---

(1) Put protective tape around the back door outside garnish sub-assembly.

(2) Detach the clip and remove the back door outside garnish sub-assembly as shown in the illustration.

